




SERVICE NEWS LETTER 060 (REV.)

DATE: JULY 10, 2001
 TO: UD DEALER SERVICE MANAGER
 FROM: NDA SERVICE OPERATIONS DEPARTMENT
 FILE IN THE POLICY SECTION OF THE TECHNICAL BULLETIN BINDER, DISCARD PREVIOUS LETTER DATED JUNE 29, 2001

AISIN AUTOMATIC TRANSMISSION OUTPUT FLANGE NUT SERVICE PROCEDURE


PURPOSE

The following information emphasizes the importance of the service torque for the output flange nut on the Aisin automatic transmission.

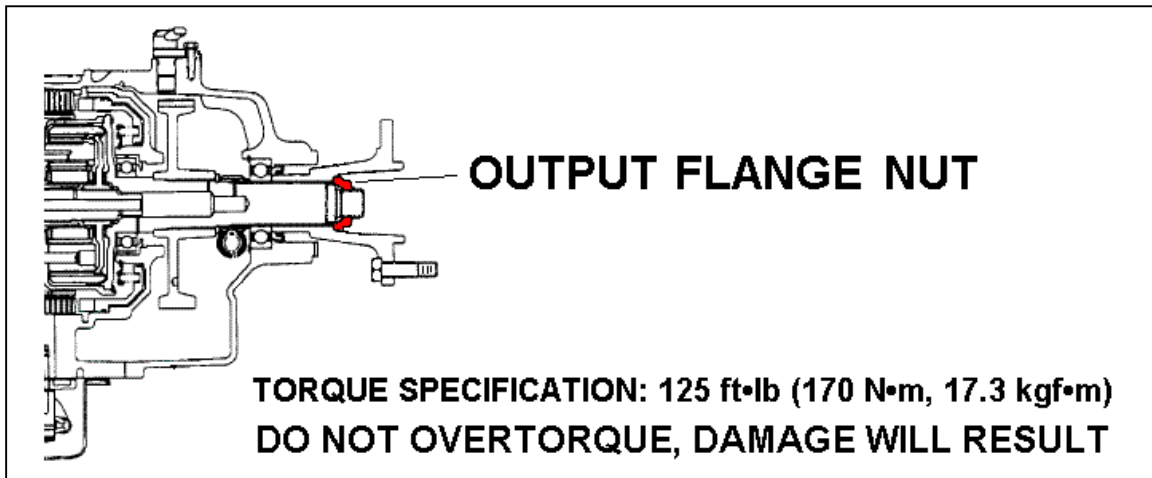

SERVICE PROCEDURES

- Whenever repair or service procedures require the removal of the output flange nut on the Aisin automatic transmission, it is recommended to install a new nut (part number 33143-29D00). New nuts are provided on all Genuine UD replacement or UD Remanufactured units.
- Using a blunt chisel, stake the nut onto the output shaft as shown.

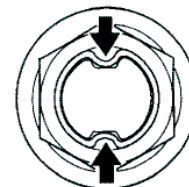

STAKE NUT WITH CHISEL

INFORMATION CONTAINED IN THIS BULLETIN SHOULD NOT BE INTERPRETTED AS THE BASIS FOR CLAIMS UNLESS SO DESIGNATED							
FOR THE INDICATED PERSONNEL BELOW PLEASE READ, INITIAL AND ROUTE TO THE FOLLOWING:							
X	SERVICE MANAGER	X	WARRANTY MANAGER	X SERVICE TECHNICIANS INITIAL BELOW:			
X	PARTS MANAGER	X	SHOP FOREMAN				